


Diagrams of Poll Range

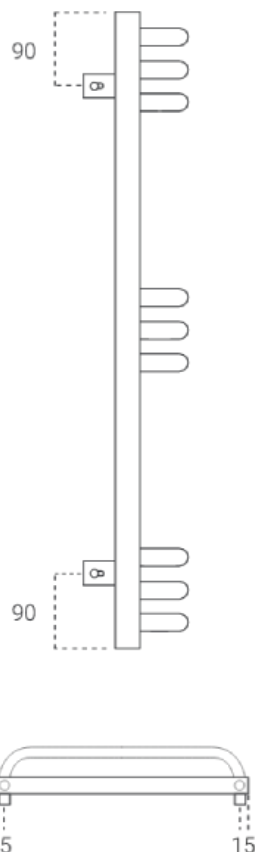

Pipe Centres

Pipe centres left to right	width - 30mm
Pipe centres from wall	57mm - 65mm
Depth from wall	132mm - 140mm

1 Unpack & Inspect

All of our products are well packaged and should reach you in perfect condition. Just in case however, the Poll offers a minimum 5-year guarantee.

Please carefully unpack and inspect this radiator and all fittings.



2 Contents

You should have:

- 1 Radiator
- 4 Wall bracket sleeves
- 1 Airvent

You will need:

- Tape measure
- Electric drill and bits
- Spirit level

3 Mark Bracket Positions

The fixing positions for the two top brackets are measured at 15mm in from either end of the top collector and measured down 90mm (please see diagram opposite).

In order to accurately mark the bottom bracket fixing positions we recommend you mark, fix and level the two top brackets first.

Then hang the radiator, ensuring it is vertically level and manually hold the bottom brackets in position while marking.

4 Fix Brackets

Using a suitable drill bit, screws and plugs, fix the brackets sleeves to the wall and level with a spirit level. Please see diagrams.



PLEASE NOTE :

It is essential that all brackets are level to ensure a vertical alignment for connecting the pipework.

5 Hang Radiator & Commission

With the brackets sleeves firmly fixed and level, slot the radiator into the sleeves and firmly fix by tightening the grub screws.

When securing the brackets, we suggest positioning the sleeves in a way which the top bracket's grub screw is facing upwards, and the bottom bracket's grub screw is facing down. This will improve the aesthetics of the radiator and avoid any screws being seen.

Please Note:

In accordance with Part L1 2006 of the Building Regulations and BS7593:1992 code of practice for the treatment of hot water and central heating systems, we strongly recommend flushing the heating system post installation of new radiators and then adding the correct quantity and type of inhibitor for use with your radiator and system to prevent corrosion. Damage caused to systems not protected by a suitable inhibitor will not be covered by manufacturer's guarantee.